

KUBOTA FILLS TRACTOR GAP

KUBOTA TRACTOR

300 WEST CAROB ST. COMPTON, CA. 90220

BULLETIN NO. SB78-37

DATE 11-2-78

PHONE 213-537-2531
TELEX 69-1362 (Compton)


SERVICE BULLETIN

SUBJECT: M4000 AND M4500 REAR WHEEL STUDS

M4000 tractors after Serial Number 10010 and all M4500 tractors up to Serial Number 10115 may have been supplied with incorrect wheel studs. The rear wheel studs supplied with the M4000 tractors and both the front and rear wheel studs supplied with the M4500 tractors may not be threaded enough to allow the wheels to be tightened.

To correct this order from the Kubota Parts Department, 16 studs (P/N 35410-49151) for the M4000 tractors and 32 of these studs for the M4500 tractors. Also submit a Warranty Request for the cost of the studs and one hour labor for units already in the field, and a claim for parts only for those units not yet assembled. Under "Description of Failure" write: Refer to SB78-37. Claims must be submitted before June 1, 1979, to receive warranty credit.

Later shipments of tractors will contain two sets of wheel studs. The correct studs to be used are packaged separately. For these units no Warranty Request will be accepted.


David L. Keup
Director of Customer Service