

**Service Bulletins**
☒ Keywords to search for existing questions/answers 

☐ View by series / model Note: Can be sorted by "Year", "Series" or "Failure code" by clicking on the arrows in the header bar.

☐ AG Only - Legacy (2020 and older) AG bulletins

☐ CE Only - Legacy (2020 and older) CE bulletins

☐ TSB Only - Technical Service Bulletins\*

☐ MSC Only - Mandatory Service Campaigns\*

☐ TIB Only - Technical Information Bulletins\*

A **Service Bulletin** is a formal advisory to dealers on Kubota approved recommended repairs, update to repair techniques or troubleshooting strategies. It can also be used to inform dealerships about improved parts, service manual updates and Mandatory Field Campaigns. The ultimate purpose of service bulletins is to improve the reliability and or the performance of the equipment.

\*These 3 categories only contain bulletins published in 2021 or later. For any campaigns or bulletins posted in 2020 or earlier, please use the AG/CE categories.


# SERVICE BULLETIN

No: **AG016 - 15**Series: **M-series**Fail Code: **ST02**Date: **03/19/2015**Issued by: **Nilil Sauv **

Director, Service &amp; Engineering

Director, Service & Engineering

Subject:	Heat Resitant O-Ring for Steering Controller	
Model(s):	M95X, M105X, M125X, M108X, M100X, M110X, M126X, M135X	
Serial Ranges:	M95X, M105X, M125X, M108X, M100X, M110X, M126X, M135X	ALL/TOUS

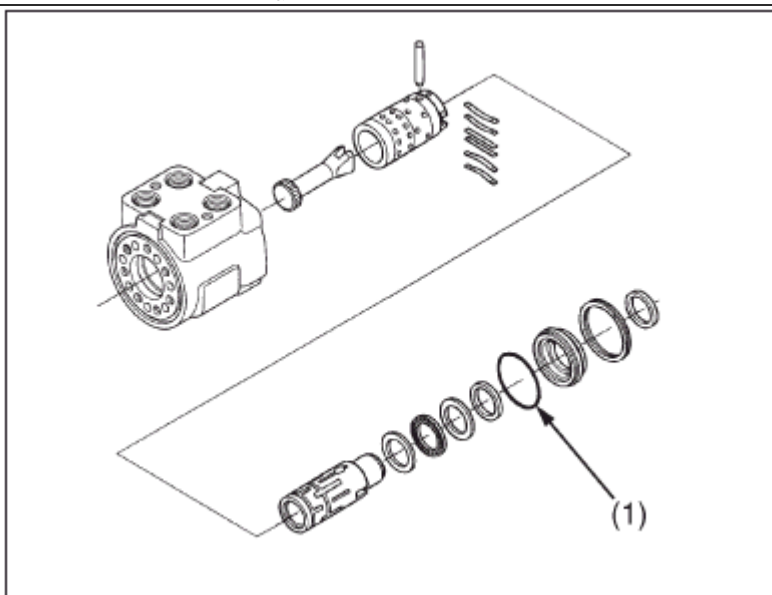

## Service Information:

Kubota has found that sometimes oil leakage can occur at the steering controller due to thermal deformation of the o-ring. If an oil leak has occurred at the steering controller due to thermal deformation of the o-ring, Kubota has available a more heat resistant o-ring which should be installed when repairing

## Parts Information:

Original Part Numbers - **DO NOT ORDER**

No.	PARTS NAME	PARTS NO.	Q'ty
1	O-RING	<b>3599922040</b>	1
1	Seal Kit	3C01197050	1

New Part Numbers (Heat Resistant)			
No.	PARTS NAME	PARTS NO.	Q'ty
1	O-RING	3T40397040	1
1	Seal Kit	3T40397050	1

The 3T40397050 SEAL, KIT includes the 3T403907040 O-RING and 3C01197050 SEAL, KIT.

Warranty Information:

Labor Allowances	TMBb-025: 1.7hr
Parts	Refer to Parts Information section above.
Service Bulletin	AG016-15
Warranty Terms	Normal Warrant Applies
Wash Code	TMMN-011: 0.8hrs
Key part number	3599922040 or 3C01197050

Additional Information:

FI-A-15-001